PRINT DATE: 12/05/00

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL HARDWARE

NUMBER: 06-18-0563 -X

SUBSYSTEM NAME: ARS - COOLING

REVISION: 1

11/22/00

## **PART DATA**

PART NAME

**PART NUMBER VENDOR NAME** 

**VENDOR NUMBER** 

LRU

: HEAT EXCHANGER, AV BAY

MC621-0008-0005

LRU

: HEAT EXCHANGER (AVIONICS BAY 3A)

HAMILTON STANDARD

MC621-0008-0705

SV755522

## **EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:**

HEAT EXCHANGER, AVIONICS BAY

~ .:

QUANTITY OF LIKE ITEMS:

ONE PER BAY

THREE PER SUBSYSTEM

## **FUNCTION:**

REMOVES EXCESS HEAT FROM AVIONICS EQUIPMENT BY COOLING CIRCULATED AIR IN BAY AND TRANSFERRING THE HEAT TO THE WATER COOLANT LOOPS.

MC621-0008-0705: MCR 19393 "AVIONICS BAY 3A FAN MOD - LONG LEAD PROCUREMENT" PROVIDES FLEXIBILITY TO INSTALL EITHER CABIN OR AVIONICS FAN IN AVIONICS BAY 3A BASED ON INDIVIDUAL MISSION CONSUMABLES AND PAYLOAD COOLING NEEDS TO IMPROVE CRYO CONSUMABLES MARGIN.

PAGE 2

PRINT DATE: 12/18/00

FAILURE MODES EFFECTS	ANALYSIS	FMEA CI	L FAILURE	MODE
-----------------------	----------	---------	-----------	------

NUMBER: 06-1B-0563-03

REVISION#: 1

11/22/00

SUBSYSTEM NAME: ARS - COOLING LRU: HEAT EXCHANGER, AV BAY

ITEM NAME: HEAT EXCHANGER, AV BAY

**CRITICALITY OF THIS** FAILURE MODE: 1R2

**FAILURE MODE:** 

INTERNAL LEAKAGE, WCL TO WCL

MISSION PHASE:

LO LIFT-OFF

OO ON-ORBIT DO DE-ORBIT

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY 104 **ATLANTIS** 

105 ENDEAVOUR

CAUSE:

MECHANICAL SHOCK, VIBRATION, CORROSION, MATERIAL DEFECT

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) PASS

B) PASS

C) PASS

PASS/FAIL RATIONALE:

A)

B)

C)

- FAILURE EFFECTS -

## (A) SUBSYSTEM:

TRANSFER OF COOLANT FROM ONE WATER LOOP TO THE OTHER UNTIL PRESSURE IN BOTH LOOPS IS EQUALIZED.

PAGE: 3 PRINT DATE: 12/18/00

# FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE

NUMBER: 06-1B-0563-03

(B) INTERFACING SUBSYSTEM(S):

NO EFFECT.

(C) MISSION:

POSSIBLE EARLY MISSION TERMINATION FOR FIRST FAILURE.

(D) CREW, VEHICLE, AND ELEMENT(S):

SECOND ASSOCIATED FAILURE (LEAKAGE OF ONE WATER COOLANT LOOP) WILL CAUSE LOSS OF ALL CABIN COOLING AND MAY RESULT IN LOSS OF CREW/VEHICLE.

(E) FUNCTIONAL CRITICALITY EFFECTS:

## -DISPOSITION RATIONALE-

#### (A) DESIGN:

HEAT EXCHANGER IS AN OVEN-BRAZED CRES PLATE-FIN UNIT. HEADER, BOSSES AND FLUID LINES WELDED ON THE PLATE-FIN CORE. THE HEAT TRANSFER FLUID IS HIGH PURITY/LOW OXYGEN CONTENT WATER. AIR FINS ARE 0.2 INCH HIGH X 0.002 INCH THICK X 24 FINS PER INCH. WATER FINS ARE 0.05 INCH HIGH X 0.002 INCH THICK X 28 FINS PER INCH. PARTING SHEETS ARE 0.004 INCH THICK.

## (B) TEST:

ACCEPTANCE TEST - LEAKAGE: AIR SIDE AT 5 IN OF H2O 0.18 LB/MIN GN2 MAX, WATER SIDE 0.001 CC/HR AT 75 PSIG. PROOF PRESSURE AT 5 IN OF H2O ON AIR SIDE AND 135 PSIG ON H2O SIDE. TUBES INSPECTED. FLOW VS. DELTA-P CHECK PERFORMED.

QUALIFICATION TEST - LEAKAGE: AIR SIDE AT 5 IN OF H2O 0.18 LB/MIN GN2 MAX. PROOF PRESSURE AT 5 IN OF H2O ON AIR SIDE AND 135 PSIG ON H2O SIDE. TUBES INSPECTED. SUBJECTED TO RANDOM VIBRATION SPECTRUM ENVELOPE OF 20 TO 150 HZ INCREASING AT 6 DB/OCTAVE TO 0.03 G\*\*2/HZ, CONSTANT AT 0.03 G\*\*2/HZ FROM 150 TO 1000 HZ, DECREASING AT 6 DB/OCTAVE FROM 1000 TO 2000 HZ FOR 48 MINUTES PER AXIS IN THREE ORTHOGONAL AXES. DESIGN SHOCK - THREE TERMINAL SAWTOOTH PULSES OF 20 G PEAK AMPLITUDE AND 11 MS DURATION APPLIED IN BOTH DIRECTIONS ALONG EACH OF THREE ORTHOGONAL AXES.

IN-VEHICLE TESTING - SYSTEM LEAK TEST IS PERFORMED AT 85 - 95 PSIG, 8 CC/MIN MAX LEAKAGE. LOOPS ARE SERVICED WITH A DELTA OF APPROXIMATELY 10% BETWEEN THEIR ACCUMULATOR QUANTITIES TO ENABLE DETECTION OF INTERLOOP LEAKAGE.

GROUND TURNAROUND TEST - ANY TURNAROUND CHECKOUT TESTING IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD

PAGE: 4 PRINT DATE: 12/05/00

## FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE

NUMBER: 06-1B-0563-03

#### (C) INSPECTION:

## RECEIVING INSPECTION

RAW MATERIAL AND PURCHASED COMPONENTS REQUIREMENTS ARE VERIFIED BY INSPECTION. PARTS PROTECTION IS VERIFIED BY INSPECTION.

### CONTAMINATION CONTROL

SYSTEMS FLUID ANALYSES FOR CONTAMINATION ARE VERIFIED BY INSPECTION. CONTAMINATION CONTROL PLAN IS VERIFIED BY INSPECTION. CONTAMINATION CONTROL PROCESSES AND CLEAN AREAS ARE VERIFIED BY INSPECTION.

#### ASSEMBLY/INSTALLATION M

ANUFACTURING, INSTALLATION AND ASSEMBLY OPERATIONS ARE VERIFIED BY INSPECTION. SHEET METAL PARTS ARE INSPECTED AND VERIFIED BY INSPECTION. SURFACE FINISHES VERIFIED BY INSPECTION. DIMENSIONS VERIFIED BY INSPECTION.

#### CRITICAL PROCESSES

WELDING IS VERIFIED BY INSPECTION. ALL WELDS ARE STRESS RELIEVED AFTER WELDING, VERIFIED BY INSPECTION. BRAZING IS VERIFIED BY INSPECTION.

## NONDESTRUCTIVE EVALUATION

HEADER WELDS TO THE TUBES ARE PENETRANT AND X-RAY INSPECTED. OTHER WELDS (MOUNTING PADS AND HEADER WELDS TO THE CORES) ARE PENETRANT AND 10X MAGNIFICATION VISUALLY INSPECTED. BRAZES ARE VERIFIED BY PROOF AND LEAK TESTS.

#### **TESTING**

INSPECTION VERIFIES THAT RESULTS OF ACCEPTANCE TESTING AND FLOWRATES ARE WITHIN SPECIFIED LIMITS.

### HANDLING/PACKAGING

HANDLING AND PACKAGING REQUIREMENTS VERIFIED BY INSPECTION.

### (D) FAILURE HISTORY:

CURRENT DATA ON TEST FAILURES, FLIGHT FAILURES, UNEXPLAINED ANOMALIES, AND OTHER FAILURES EXPERIENCED DURING GROUND PROCESSING ACTIVITY CAN BE FOUND IN THE PRACA DATA BASE.

#### (E) OPERATIONAL USE:

~ ,

TBS.

- APPROVALS -			
S&RE ENGINEERING S&RE ENGINEERING ITM DESIGN ENGINEERING DESIGN ENGINEERING SSM MOD	: P. CHAN : P. STENGER-NGUYEN : K. DUONG : S. NGUYEN : P. HASERLOOK	F. Storm Properson	

PAGE: 5 PRINT DATE: 12/05/00

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE NUMBER: 06-1B-0563- 03

USA / SAM

**USA ORBITER ELEMENT** 

~ ,: